

Date: Thursday, 2/22/2007 3:16:12 PM
 User: Kim Johnston

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : 350 SKIDTUBE ASSEMBLY LH
 Job Number : 30863
 Estimate Number : 10262
 P.O. Number : N/A
 This Issue : 2/22/2007 S.O. No. : N/A
 Prsht Rev. : NC
 First Issue : N/A Type : LANDING GEAR
 Previous Run : 30862
 Written By :
 Checked & Approved By : *07.02.23*
 Comment : Est Rev: 02.09.25 Rearranged procedure stepsKJ
 Est Rev:J 06-03-23 As per Rev D JLM
 Est Rev:J 06-07.13 As per dsi9343 EC

Part Number : D350636011
 Drawing Number : D2750 UNDER REVIEW *CB 07.02.23*
 Project Number : N/A
 Drawing Revision : D
 Material : N/A
 Due Date : 3/21/2007 Qty: 1 Um: Each

Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 DC DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy blue file and type labels per PPP D350-636-011 CHG 002

07.03.01

2.0 D26003BENT Extrusion Bent



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2600-3-Bent

Extrusion (Bent)

B 30666

07-03-22

3.0 D2744 Fwd Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Cap

Batch

229784 BE 07-03-26

4.0 LANDING GEAR 1 LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1- Mark cut line on aft end of D2600-3-Bent using Jig DT 8150. Cut to length as per Dwg D2750. Deburr end

2-Drill pilot holes as per Dwg D2750 sheet 3 (D2750-1 details).Drill using drill Jig DT8150 & DT8863 drilling holes labelled "A" only.

3- Mark fwd end for cutting using Drill Jig DT 8150 & DT8863 and cut

07-03-22

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 30863

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description:

as per dwg D2750.

4-Drill pilot holes for Detail B using DT8330

5-Open up holes for Detail B, "hole size W" and blade fitting location holes to 0.500" (total of 9 holes per side) as per dwg D2750

6-Drill pilot holes for wearplates as per Dwg D2750 using DT8108 and open to 0.250" ***Make sure that wearplate holes are on bottom of tube*****

7-Open up holes of Detail A to 0.250" (total of 2 holes per side)

8- Countersink all fwd wearshoe holes (total of 19 holes per side) DO NOT C'SINK THE LAST AFT HOLES (total of 2 per side for blade fitting) as per dwg D2750.

9-Weld D2744 Cap as per Dwg D2750 and QSI 004. Fill grooves in bend left from bending as per QSI 004
A/R Aluminum Rod *M 102421 BE 07-03-26*

10-Grind welds flush as per Dwg D2750 *BE 07-03-27*

11-Countersink Detail A as per dwg D2750. *BE 07-03-27*

12- Scribe batch# inside per dwg D2750 *BE 07-03-27*

5.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

6.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

7.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

8.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

K
07-03-22

A 07-03-26

DP 7-3-29

K 07-03-29

Pm 07-03-29

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes- No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

Date: Thursday, 2/22/2007 3:16:12 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 30863

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description :

9.0

D2739

350 I Beam



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Web

Batch:

B31526

07-04-02

10.0

D34901

CROSS BOLT SPACER



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Crossbolt spacer

Batch:

B30565

BE 07-04-05

11.0

D34903

CROSS BOLT SPACER



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Crossbolt spacer

Batch:

B29982

BE 07-04-05

12.0

D2743

Crossbolt Spacer



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Crossbolt Spacer

Batch:

B30448

BE 07-04-05

13.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open up holes of Detail V & Detail C to 0.625" (total of 8 holes per side)
as per dwg D2750.

2-Open up holes of Detail D to 0.750" (total of 4 holes per side)
as per dwg D2750.

3-Chamfer holes of Detail V, Detail C, Detail D and hole size "W" per dwg D2750 (welding instructions on
sheet 4)

4-Deburr and blow out all chips from inside of tube

6-Bond web D2739 in place as per QSI 015

A/R

Sikaflex-291

batch:

M103561

exp. date:

07-10-01

7- Weld spacers D3490-1, D3490-3 and D2743 as per dwg D2750 & QSI004

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|--------------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

Date: Thursday, 2/22/2007 3:16:12 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 30863

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description:

(welding instructions on sheet 4)

A/R Aluminum Rod batch: *M103317 BE 07-04-05*

8-Grind welds flush as per Dwg D2750 *Pm 07-04-09 ①*

9-Spot face ground handling holes section J-J (total of 4 places per side) as per dwg D2750 *Pm 07-04-09 ①*

10-Deburr holes *Pm 07-04-09 ①*

14.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

07/04/10

15.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

07/04/10

16.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat Gloss White (Ref. 4.3.5.1) as per Dart QSI 005 4.3

07-04-18 ①

17.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

Inspect for foreign object per QSI 024

M-L 07/04/19

18.0

NAS1330S3KB166

INSERT



Comment: Qty.: 42.0000 Each(s)/Unit Total: 42.0000 Each(s)

INSERT

Batch: *M103472 (x21) M101935 (x21)*

19.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Install inserts as per Dwg D2750

07/04/19 ①

20.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

Inspect Inserts

ml 07 04 19 ①

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

Date: Thursday, 2/22/2007 3:16:12 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 30863

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description :

21.0

D26483

Wearpad



Comment: Qty.: 5.0000 Each(s)/Unit Total : 5.0000 Each(s)

Wearpad

Batch: B29777

22.0

D265613

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Wearplate

Batch: B29976

23.0

D265635

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Wearplate

Batch: B29337

24.0

D2746

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Wearplate

Batch: B30141

25.0

D2745

Bushing



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Bushing

Batch: B30568

26.0

D3488041

BLADE FITTING ASSEMBLY, LH



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Blade Fitting, LH

Batch: B30111

27.0

D3492041

PLUG ASSEMBLY



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

PLUG ASSEMBLY

Batch: B29797

FL

07/04/19 ①

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

Date: Thursday, 2/22/2007 3:16:12 P.M.
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopter Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 30863

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description :

28.0

D3492043

PLUG ASSEMBLY



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

PLUG ASSEMBLY

Batch: B29984

29.0

AN3C5A

Bolt



Comment: Qty.: 38.0000 Each(s)/Unit Total : 38.0000 Each(s)

Bolt

Batch: M103481

30.0

AN3C6A

BOLT



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Bolt

Batch: M103693

31.0

AN3C7A

BOLT



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

BOLT

Batch: m19522

32.0

AN6C44A

BOLT



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

BOLT

Batch: m103692

33.0

AN8C35A

BOLT



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

BOLT

Batch: m102180

34.0

AN960C10L

washer



Comment: Qty.: 46.0000 Each(s)/Unit Total : 46.0000 Each(s)

washer

Batch: m103641

FL

07/04/19 ①

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

Date: Thursday, 2/22/2007 3:16:12 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 30863

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description :

35.0

AN960C816L

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

WASHER

Batch: m100186

36.0

MS210436

NUT



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

NUT

Batch: m102532

37.0

MS21083C8

NUT



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

NUT

Batch: m103492

38.0

NAS1515H3L

WASHER



Comment: Qty.: 46.0000 Each(s)/Unit Total : 46.0000 Each(s)

WASHER

Batch: m103641

39.0

NAS1515H8L

WASHER



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

WASHER

Batch: m103617

FER 07/04/19 ①

40.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Inspect for Foreign Objects

2-Spray inside of tube with "LPS-3" batch: m104099

3-Install blade fitting D3488-041, wearshoes and ground handling hardware as per dwg D2750

SIKA FLEX 241

BATCH: m103497

EXP DATE: 07/10

FER 07/04/19 ①

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|--------------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

Date: Thursday, 2/22/2007 3:16:12 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 30863

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description :

①

4-Coat all exposed fasteners with "LPS Procyon"

batch:

M17168

M-R 07/04/11

41.0

QC5

INSPECT WORK TO CURRENT STEP



2004-230



Comment: INSPECT WORK TO CURRENT STEP

42.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

43.0

D2741

Blade



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Blade

Batch:

130556

44.0

AN960C816L

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Washer

Batch:

M100186

45.0

MS21083C8

NUT



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Nut

Batch:

M100186

46.0

AN8C21A

BOLT



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Bolt

Batch:

M103547

47.0

NAS1515H8L

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

WASHER

Batch:

M102515

7/4/23 SP

Dart Aerospace Ltd

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☒ No ☐ DQA: ☒ Date: 07/04/24
 QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

Date: Thursday, 2/22/2007 3:16:12 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH

Job Number: 30863

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description :

48.0

D34931

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

WASHER

Batch: B30662 ✓

49.0

D35321

spacer



Comment: Qty.: 2.0000 (s)/Unit Total : 2.0000 (s)

batch: B37894 ✓

7/4/23/SP

50.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

C207104/240 EPO4/240

51.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Package as per PPP D350-636-011

EPO4/240 (1)

REV: E

52.0

QC21

FINAL INSPECTION/W/O RELEASE



(1)

Comment: FINAL INSPECTION/W/O RELEASE

EPO4/24

Job Completion



U 0704-24

30863

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries



| | | | |
|----------------------|-----------------------|---|------------------------|
| DESIGN <i>PH</i> | DRAWN BY <i>PH</i> | DART AEROSPACE USA, INC. PORT HADLOCK, WA | |
| CHECKED <i>HH</i> | APPROVED <i>HH</i> | DRAWING NO. D2750 | REV. D SHEET 1 OF 5 |
| DATE 06.01.05 | | TITLE 350 SKIDTUBE ASSEMBLY SCALE NTS | |
| A | 98.04.16 | NEW ISSUE | |
| B | 98.09.01 | CHANGE MS24694-S293 TO AN8-16A | |
| C | 98.11.18 | ADD D2750-3/D2750-4 INCORPORATE D2738 AND D2740 | |
| D | 06.01.05 | ADD HOLES AND SPACERS FOR APICAL FLOATS INCORPORATE DEO 9133/9157 | |

RELEASED
06.02.07 *HH*

UNDER REVIEW *OK*
CB

07.02.05 *CB*

*add gaskets
change to SS wearplates*

| Qty -041 | Qty -042 | Qty -043 | Qty -044 | Part Number | Description |
|-------------|-------------|-------------|-------------|----------------|-----------------------|
| X | | | | D2750-041 | SKIDTUBE ASSEMBLY, LH |
| | X | | | D2750-042 | SKIDTUBE ASSEMBLY, RH |
| | | X | | D2750-043 | SKIDTUBE ASSEMBLY, LH |
| | | | X | D2750-044 | SKIDTUBE ASSEMBLY, RH |
| 5 | 5 | 5 | 5 | D2648-3 | WEARPAD |
| 1 | 1 | 1 | 1 | D2656-13 | WEARSHOE |
| 1 | 1 | 1 | 1 | D2656-35 | WEARSHOE |
| 1 | 1 | 1 | 1 | D2746 | WEARSHOE |
| 1 | 1 | 1 | 1 | D2739 | WEB |
| 1 | 1 | 1 | 1 | D2741 | BLADE |
| 8 | 8 | 8 | 8 | D2743 | SPACER |
| 1 | 1 | 1 | 1 | D2744 | CAP |
| 8 | 8 | 8 | 8 | D2745 | BUSHING |
| 1 | | | | D2750-1 | SKIDTUBE WELDMENT, LH |
| | 1 | | | D2750-2 | SKIDTUBE WELDMENT, RH |
| | | 1 | | D2750-3 | SKIDTUBE WELDMENT, LH |
| | | | 1 | D2750-4 | SKIDTUBE WELDMENT, RH |
| 1 | | 1 | | D3488-041 | BLADE FITTING, LH |
| | 1 | | 1 | D3488-042 | BLADE FITTING, RH |
| 4 | 4 | 4 | 4 | D3490-1 | SPACER |
| 4 | 4 | | | D3490-3 | SPACER |
| | | 4 | 4 | D3490-5 | SPACER |
| 8 | 8 | 8 | 8 | D3492-041 | PLUG ASSEMBLY |
| 8 | 8 | | | D3492-043 | PLUG ASSEMBLY |
| | | 8 | 8 | D3492-045 | PLUG ASSEMBLY |
| 38 | 38 | 38 | 38 | AN3C5A | BOLT |
| 4 | 4 | 4 | 4 | AN3C6A | BOLT |
| 4 | 4 | 4 | 4 | AN3C7A | BOLT |
| 4 | 4 | 4 | 4 | AN6C44A | BOLT |
| 2 | 2 | 2 | 2 | AN8C21A | BOLT |
| 1 | 1 | 1 | 1 | AN8C35A | BOLT |
| 46 | 46 | 46 | 46 | AN960C10L | WASHER |
| 4 | 4 | 4 | 4 | AN960C816L | WASHER |
| 4 | 4 | 4 | 4 | MS21043-6 | NUT |
| 3 | 3 | 3 | 3 | MS21083C8 | NUT |
| 42 | 42 | 42 | 42 | NAS1330S3KB166 | INSERT |
| 46 | 46 | 46 | 46 | NAS1515H3L | WASHER |
| 12 | 12 | 12 | 12 | NAS1515H8L | WASHER |

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. **30863**

Copyright © 1998 by DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.



| | | | |
|------------------|--------------------------------|--|------------------------|
| DESIGN PH | DRAWN BY PH | DART AEROSPACE USA, INC. PORT HADLOCK, WA | |
| CHECKED H | APPROVED H | DRAWING NO. D2750 | REV. 0 SHEET 2 OF 5 |
| DATE 06.01.05 | TITLE 350 SKIDTUBE ASSEMBLY | | SCALE NTS |

UNDER REVIEW

07.01.05 CB

35 wearplates

OK
CB

RELEASED
06.02.07 H


GENERAL NOTES:

1. ALL DIMENSIONS ARE IN INCHES
2. TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
3. MAKE FROM D2600-3 EXTRUSION (INITIAL LENGTH = 120.0).
4. DAMAGE TOLERANCE ON BENDING:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 12 INCHES ABOVE THE GROUND. NO GOUGING IS ACCEPTABLE IN THE FLAT PORTION OF THE TUBE. GOUGES UP TO 0.020 ARE ACCEPTABLE IN THE BENT PORTION OF THE TUBE. TUBE O.D. SHOULD BE 3.150 ± 0.010 IN THE FLAT PORTION OF THE TUBE. TUBE O.D. SHOULD BE 3.15 ± 0.030 IN THE BENT PORTION OF THE TUBE.
5. ALL HOLES DRILLED ON CENTERLINES EXCEPT THOSE NOTED BY SECTIONS E-E, F-F, AND R-R.
6. WELDING TO BE DONE PER DART QSI 004.
7. FINAL CONFIGURATION SHOULD HAVE THE FOLLOWING MINIMUM MECHANICAL PROPERTIES:
MINIMUM YIELD TENSILE STRENGTH = 35 ksi
MINIMUM ULTIMATE TENSILE STRENGTH = 38 ksi
8. FINISH:
ACID ETCH, ALODINE ASSEMBLY PER DART QSI 005 4.1 PRIOR TO INSTALLING D2739 WEB.
POWDER COAT WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED TO 1.0 ABOVE SKIDTUBE CENTER-LINE PER DART 005 4.4 (OPTIONAL).
9. INSTALL NAS1330S3KB166 INSERTS AFTER FINISH AS INDICATED IN D2750-1/-2/-3/-4 WELDING DETAIL ON PAGE 4 AND 5. DRILL 'E' SIZE HOLES ($\emptyset 0.250$ - $\emptyset 0.257$) FOR WEARSHOE INSERTS. C'SINK $\emptyset 0.391 \times 100^\circ$ AND INSTALL INSERTS
10. D3488-041 (OR D3488-042) BLADE FITTING AND AN3-5A/AN3-7A WEARSHOE SCREWS TO BE INSTALLED USING SIKAFLEX-241 (OR EQUIVALENT) SEALANT.
11. SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
12. APPLY A LAYER OF SIKAFLEX -241/-291 ADHESIVE BETWEEN THE BOTTOM OF THE SKIDTUBE ASSEMBLY AND THE WEARPLATES

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WORK ORDER
NO. 30863

Copyright © 1998 by DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

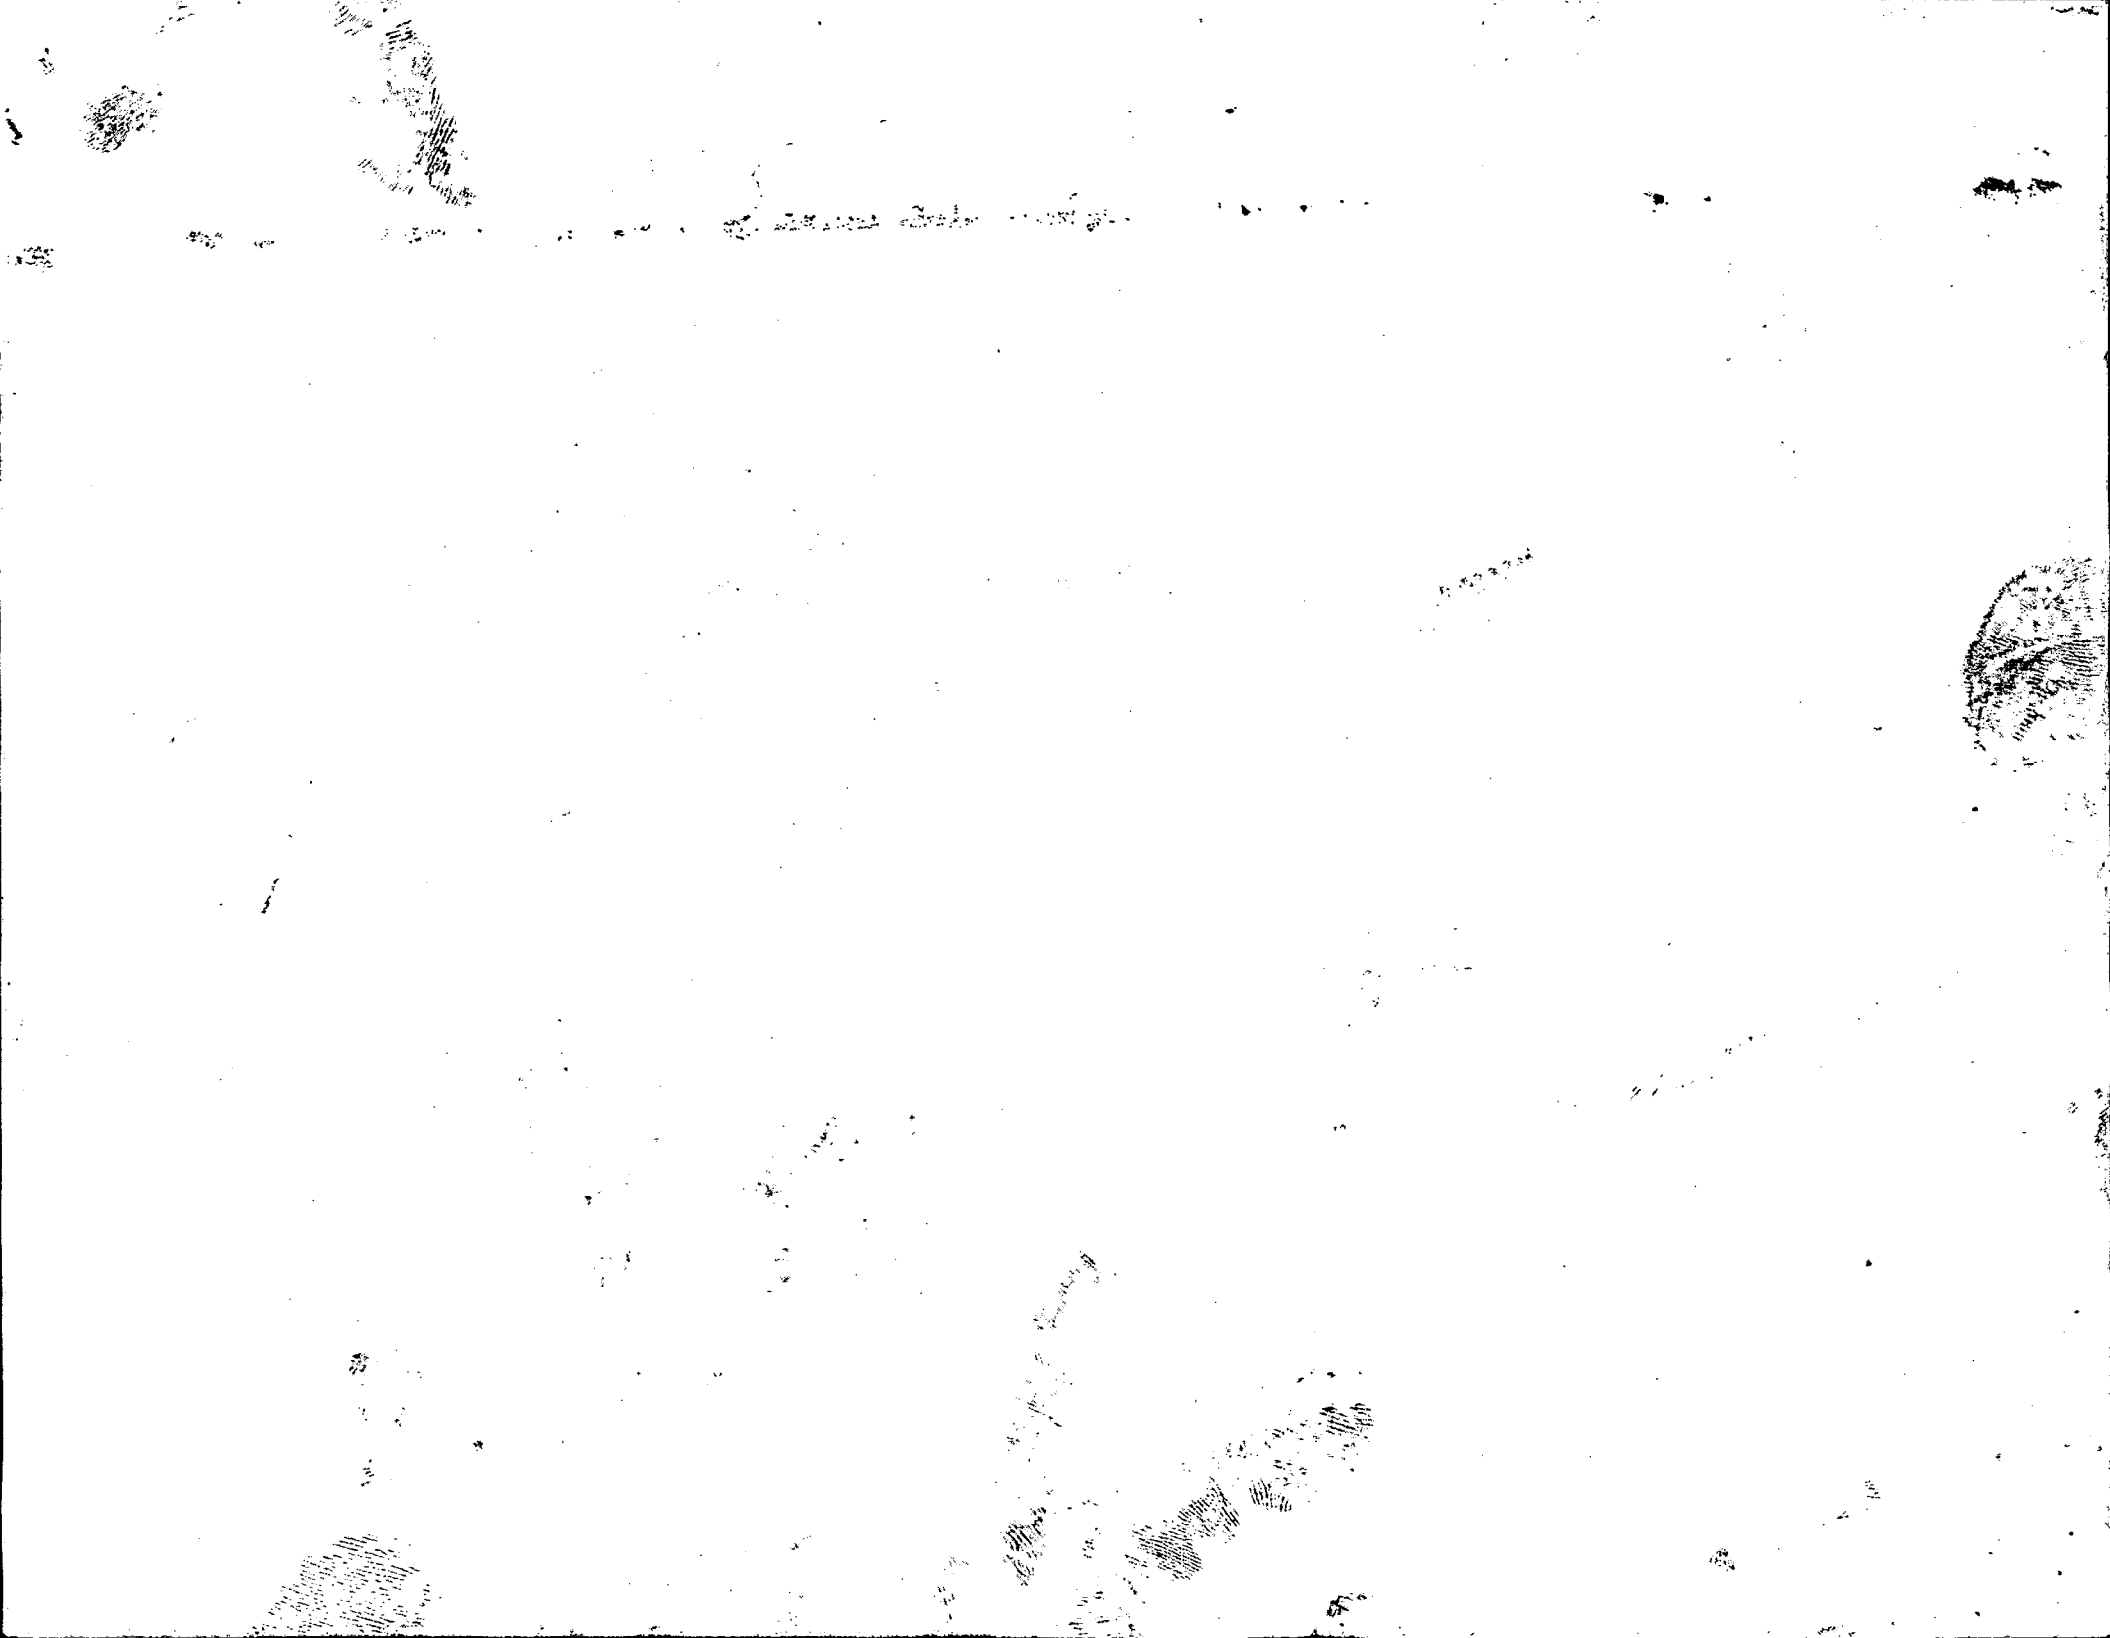



UNDER REVIEW

OK
CB


07-01-05 CB

55-000-plates

RELEASED
06-02-07

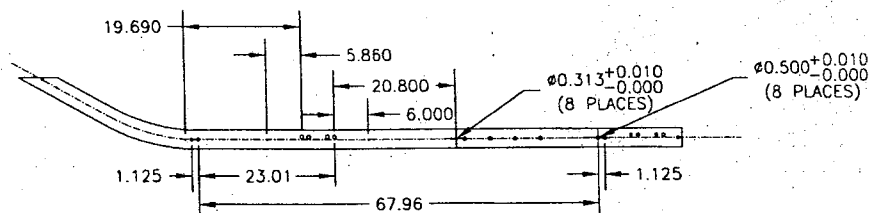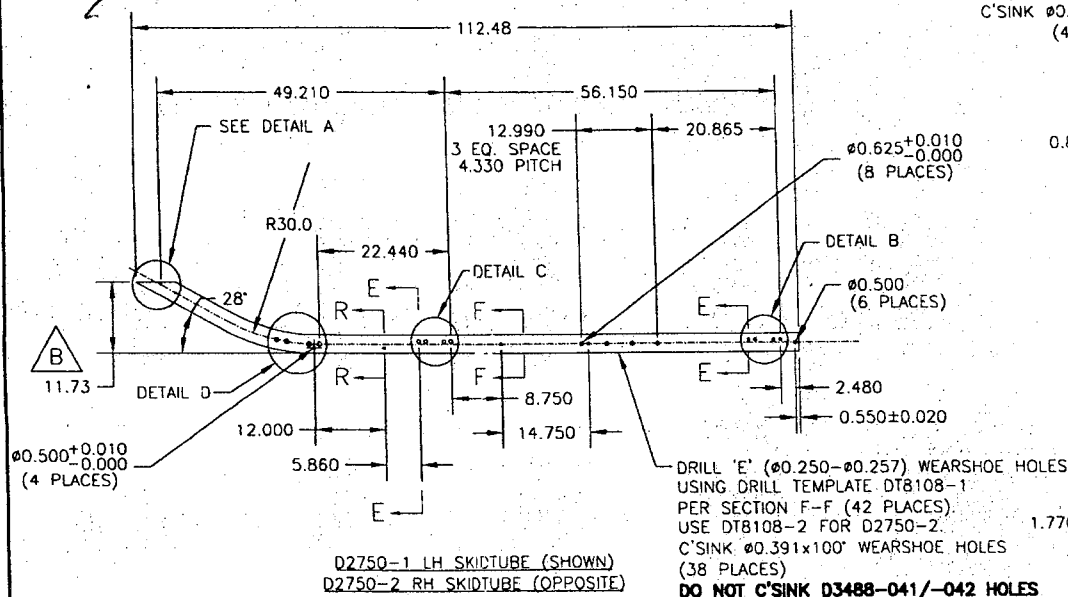

D2750-3/-4 AND D2750-1/-2 HAVE THE SAME SADDLE AND GROUND HANDLING HOLES

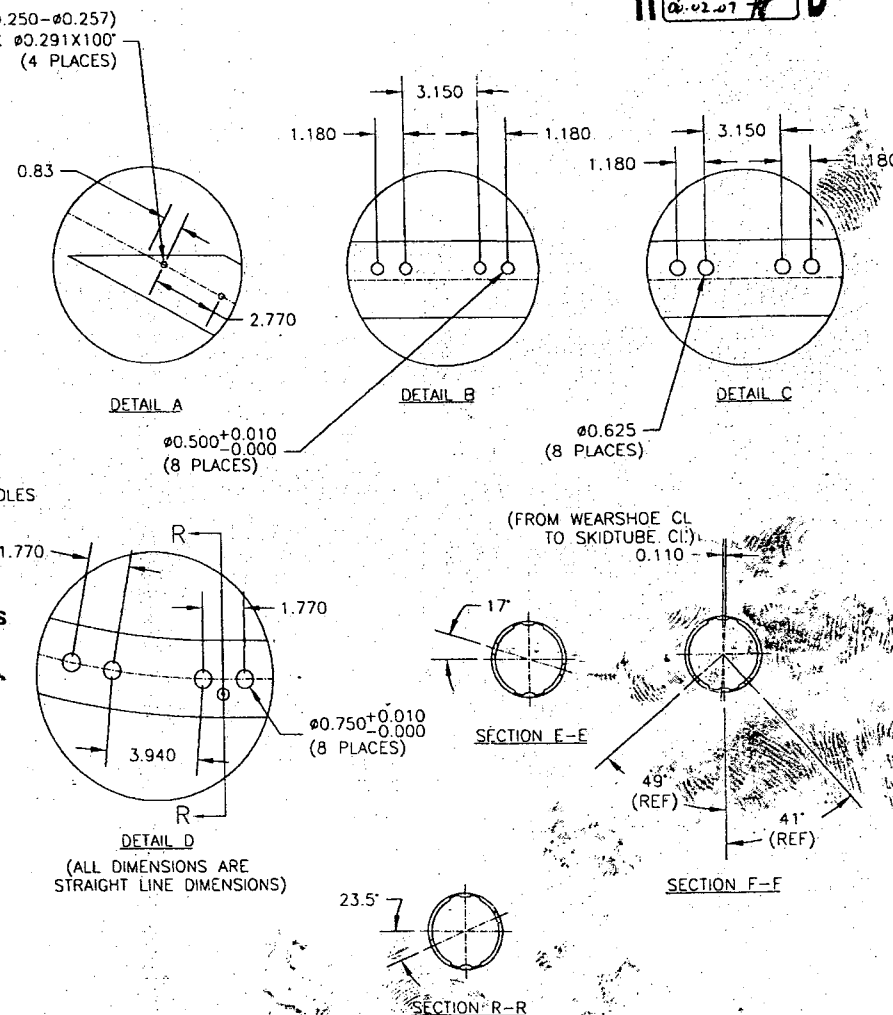

| | | | | | |
|---|--|--------------------------------|-------------|--|------------------------|
| COPYRIGHT © 1988 BY DART AEROSPACE USA, INC. | | DESIGN PH | DRAWN BY PH | DART AEROSPACE USA, INC. PORT HADLOCK, MA | |
| THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC. | | CHECKED # | APPROVED # | DRAWING NO. D2750 | REV. 0 SHEET 3 OF 5 |
| DATE 06.01.05 | | TITLE 350 SKIDTUBE ASSEMBLY | | SCALE 1:20 | |

NO. 30803
WORK ORDER
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE

UNDER REVIEW

07.01.05 CB
OK CB

INSTALL NAS1330S3KB166
INSERTS (4 PLACES)
AFTER FINISH

D2750-041/-042 ASSEMBLY
D2750-041 SHOWN (D2750-042 OPPOSITE)

BOND D2739 WEB INTO D2750-1 (OR D2750-2)
OUTER TUBE WITH NON-STRUCTURAL
SIKAFLEX-241 ADHESIVE PER DART QSI 015.
NOTE: ENSURE THAT HOLES LINE UP.

SEE DET. P
SEE DET. N
D3488-041
(OR D3488-042)

BLACK ANTI-SKID

SEE DET. Q

DETAIL G

INSTALL NAS1330S3KB166
WEARSHOE INSERTS (38 PLACES)
AFTER FINISH

RELEASED
06.02.07 #

D2648-3

D2648-3

D2656-13


D2648-3

SEE DET. K


NO INSERT

WELDED SPACER
NOT REQUIRED


DETAIL G

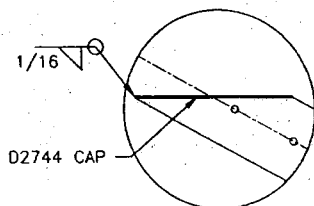

SECTION H-H D2743 SPACER (REF)

 

SECTION J-J

 

WELDING INSTRUCTIONS

1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2743 SPACER
3. WELD INTO PLACE
4. GRIND FLUSH
5. DRILL OUT SPACER TO $\phi 0.484$
6. SPOT FACE $\phi 0.750$ (SECTION J-J ONLY)

SECTION L-L

D3490-3 SPACER (TYP)

$\phi 0.750$ HOLES ONLY

D3492-043 PLUG ASSEMBLY

SECTION S-S

D3490-1 SPACER
 $\phi 0.500$ HOLES ONLY

D3492-041 PLUG ASSEMBLY

WELDING INSTRUCTIONS

1. CHAMFER HOLE 0.050 X 45°
2. INSERT D3490-1 SPACER (4 PLACES) INTO $\phi 0.500$ HOLES OR INSERT D3490-3 SPACER (4 PLACES) INTO $\phi 0.750$ HOLES
3. WELD INTO PLACE
4. GRIND FLUSH
5. INSERT D3492-041 PLUG ASSEMBLY (8 PLACES) INTO D3490-1 SPACER OR INSERT D3492-043 PLUG ASSEMBLY (8 PLACES) INTO D3490-3 SPACER ON BOTH ENDS


DETAIL K

USE AN3C7A BOLTS
FOR INSTALLING AFT
D2648-3 WEARPAD
(4 PLACES)




AN3C5A BOLT (1)
AN960JD10L WASHER (1)
NAS1515H3L WASHER (1)
(38 PLACES)

DETAIL M

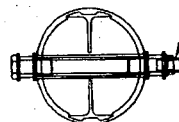


AN6-44A BOLT (1)
D2745 BUSHING (2)
NAS1515H8L WASHER (2)
MS21043-6 NUT (1)
(4 PLACES)
NOTE: INSTALL WASHER BETWEEN
SKIDTUBE AND BUSHING

DETAIL N

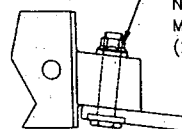

AN8C21A BOLT (1)
AN960JDB16L WASHER (1)
NAS1515H8L WASHER (1)
MS21083C8 NUT (1)
(2 PLACES)

DETAIL P

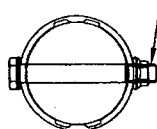

AN8C35A BOLT (1)
AN960C816L WASHER (2)
NAS1515H8L WASHER (2)
MS21083C8 NUT (1)

DETAIL Q



AN3C6A BOLT (1)
AN960C10L WASHER (1)
NAS1515H3L WASHER (1)
(4 PLACES)

WORK ORDER
NO. 20002
ENGINEERING
RETURN TO
SHOE COPY

COPYRIGHT © 1998 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE USA, INC.

| | | | |
|------------------|----------------|--|---------------|
| DESIGN PH | DRAWN BY PH | DART DART AEROSPACE USA, INC. FORT HADLOCK, MA | REV. D |
| CHECKED # | APPROVED # | DRAWING NO. D2750 | SHEET 4 OF 5 |
| DATE 06.01.05 | | TITLE 350 SKIDTUBE ASSEMBLY | SCALE 1:20 |

UNDER REVIEW

01.05.05 CB

OK CB


SEE DET. Q

DETAIL G

INSTALL NAS1330S3KB166
WEARSHOE INSERTS (38 PLACES)
AFTER FINISH

RELEASED
06.02.07.7

DETAIL G

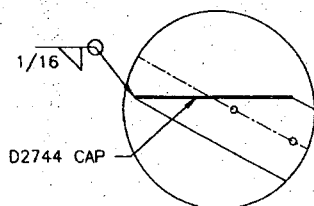

DETAIL K
USE AN3C7A BOLTS
FOR INSTALLING AFT
D2648-3 WEARPAD
(4 PLACES)

AN3C5A BOLT (1)
AN960C10L WASHER (1)
NAS1515H3L WASHER (1)
(38 PLACES)

DETAIL P
AN8C35A BOLT (1)
AN960C816L WASHER (2)
NAS1515H8L WASHER (2)
MS21083C8 NUT (1)

INSTALL NAS1330S3KB166
INSERTS (4 PLACES)
AFTER FINISH

D2750-043/-044 ASSEMBLY
D2750-043 SHOWN (D2750-044 OPPOSITE)

BOND D2739 WEB INTO D2750-3 (OR D2750-4)
OUTER TUBE WITH NON-STRUCTURAL
SIKAFLEX-241 ADHESIVE PER DART QSI 015.
NOTE: ENSURE THAT HOLES LINE UP.

SEE DET. P
SEE DET. N
D3488-041
(OR D3488-042)

BLACK ANTI-SKID

D2741

SEE DET. M

NO INSERT

WELDED SPACER
NOT REQUIRED

SEE DET. K

 
D2648-3

D2648-3


D2656-13

D2648-3

SECTION H-H D2743 SPACER (REF)




SECTION J-J

 

WELDING INSTRUCTIONS


1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2743 SPACER
3. WELD INTO PLACE
4. GRIND FLUSH
5. DRILL OUT SPACER TO Ø0.484
6. SPOT FACE Ø0.750 (SECTION J-J ONLY)

DETAIL M

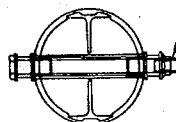

AN6C44A BOLT (1)
D2745 BUSHING (2)
NAS1515H8L WASHER (2)
MS21043-6 NUT (1)
(4 PLACES)
NOTE: INSTALL WASHER BETWEEN
SKIDTUBE AND BUSHING

DETAIL Q

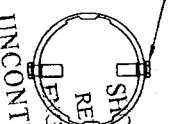

AN3C6A BOLT (1)
AN960C10L WASHER (1)
NAS1515H3L WASHER (1)
(4 PLACES)

SECTION T-T

D3490-1 SPACER



Ø0.500 HOLES ONLY

D3492-041 PLUG ASSEMBLY

SECTION U-U

D3490-5 SPACER




Ø0.313 HOLES ONLY

D3492-045 PLUG ASSEMBLY

WELDING INSTRUCTIONS

1. CHAMFER HOLE 0.050 X 45°
2. INSERT D3490-5 SPACER (4 PLACES) INTO Ø0.313 HOLES OR INSERT D3490-1 SPACER (4 PLACES) INTO Ø0.500 HOLES
3. WELD INTO PLACE
4. GRIND FLUSH
5. INSERT D3492-045 PLUG ASSEMBLY (8 PLACES) INTO D3490-5 SPACER OR INSERT D3492-041 PLUG ASSEMBLY (8 PLACES) INTO D3490-1 SPACER ON BOTH ENDS

DETAIL N

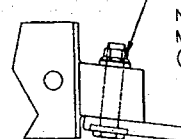

AN8C21A BOLT (1)
AN960JD816L WASHER (1)
NAS1515H8L WASHER (1)
MS21083C8 NUT (1)
(2 PLACES)

COPYRIGHT © 1998 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE USA, INC.

| | | | | |
|---------|----------|----------|-----------------------|--|
| DESIGN | PH | DRAWN BY | PH | DART DART AEROSPACE USA, INC. PORT HADLOCK, WA |
| CHECKED | PH | APPROVED | PH | DRAWING NO. D2750 |
| DATE | 06.01.05 | TITLE | 350 SKIDTUBE ASSEMBLY | REV. D SHEET 5 OF 5 SCALE 1:20 |

SHOOT COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
08602

NO. 102

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name Barclay Elliott
Joint Welding Procedure Tig
Part number and Job number A350636013 / B30642

TEST WELDS REQUIRED

BASE METAL Alum WELDING PROCESS Tig
Penetration Complete ☐ Partial ☒ Single Weld ☒ Double Weld ☐
Current AC ☒ DC ☐ Backing YES ☐ NO ☒

| | Position | Vertical | Down <input type="checkbox"/> | Up <input type="checkbox"/> |
|--------------|-----------------------------|--|-------------------------------|-----------------------------|
| Sheet Groove | 1G <input type="checkbox"/> | 2G <input checked="" type="checkbox"/> | 3G <input type="checkbox"/> | 4G <input type="checkbox"/> |
| Tube Groove | 1G <input type="checkbox"/> | 2G <input checked="" type="checkbox"/> | 5G <input type="checkbox"/> | 6G <input type="checkbox"/> |
| Sheet Fillet | 1F <input type="checkbox"/> | 2F <input checked="" type="checkbox"/> | 3F <input type="checkbox"/> | 4F <input type="checkbox"/> |
| Tube Fillet | 1F <input type="checkbox"/> | 2F <input checked="" type="checkbox"/> | 4F <input type="checkbox"/> | 5F <input type="checkbox"/> |

Crossbolt Spacer Welded into Skidtube

TEST RESULTS

Visual Pass ☒ Fail ☐
Penetration Pass ☒ Fail ☐
Crossbolt Spacer Pass ☒ Fail ☐

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

Date of Test Coupon 07/04/05 Qualifier David Naval